





# PCM161



PCM161 pressure sensor allows a combined pressure and temperature measurements at a same location. Wetted parts being all stainless steel, it is compatible with all common and hostile pressure media used in aerospace and automotive. Miniature dimensions, low mass and ruggedized design make PCM161 pressure sensor well adapted to embedded applications on vehicules, aircrafts, missiles, satellites, etc.

The pressure transducer utilizes EFE thin film technology and a platinum RTD senses media temperature. The pressure and temperature devices are designed to operate independently.

Output for pressure is an unamplified (mV/V) while temperature signal is directly the one from PT100 or PT1000 sensor. Its small package and low mass make it very adapted to application where space is at a premium.

PCM161 is available with pressure ranges from -1 to 500bar and has high temperature capability, up to -55/+175°C.

Models with built-in electronics are also available in PCM160 series with both 5V regulated (PCM163) and unregulated power supply from 8 to 16Vdc (PCM167).

#### **FEATURES**

- All Stainless Steel Ruggedized Design
- Pressure & Temperature Measurements
- High Accuracy
- Available with -55 to +175°C option

#### **APPLICATIONS**

Χ	Aerospace
X	Energy / Nuclear
X	Automotive
X	Test Benches
	Others







# TECHNICAL SPECIFICATIONS

## • Pressure Specifications

Pressure ranges (FS)	-1/+2bar; -1/+3bar; -1/+4bar; 3bar; 5bar; 10bar; 20bar; 40bar; 100bar; 250bar; 400bar; 500bar -14.5/+30PSI; -14.5/+40PSI; -14.5/+60PSI; 40PSI; 70PSI; 150PSI; 300PSI; 500PSI; 1500PSI; 3000PSI; 5000PSI; 7000 PSI				
Туре	Absolute ; Gage				
Type (for ranges > 40 bar)	Sealed Gage				
Safe overload	150% FS				
Burst pressure	300% FS or 1000bar whichever is less for M10x1 and 3/8-24 UNF male 300% FS or 400bar whichever is less for M8x1 male				

## • Electrical Specifications

Power Supply	5 to 15Vdc filtered and stabilized				
Consumption	< 10mA				
Insulation	> 1000 M0hms under 50Vdc at ambient temperature				
Offset	<±3%FS				
Sensitivity	2 to 5mV/V				
Signal convention	For compound ranges (-1 to +3bar for example), offset is at atmospheric pressure and sensor's signal @ -100%FS (-1bar) is proportionnal to signal @ +100%FS (+3bar). Sensitivity is the sensor's signal from -100% to +100%FS (4bar).				

2







#### Accuracy

Nonlinearity & hysteresis combined (Pressure)	±0.25% FS typ. / ±0.35% FS max.
Non repeatability for Pressure	±0.02% FS typ.
Thermal probe	PT1000 Class A: ±0.1% FS
Thermal probe	Option : PT100 Class A (±0.1% FS)

# • Environmental Specifications

Compensated temperature range	0 to 60°C Option : any range between -55 and +175°C
Operating temperature range	-40 to +125°C Option : -55 to +175°C (if similar option of compensated temperature range is selected)
Combined thermal zero & sensitivity shift	±0.02%FS/°C
Vibrations	20-2000Hz, 50g max.
Mechanical shock	100g ½ sinus 1ms
EMC protection	Compliant to EN61000

## Technical Specifications

Electrical connection	6-pin MIL C-26482 receptacle			
Mechanical connection	M10x1-4h male ;			
	Options : 3/8-24 UNF-3A male, M8x1-6g male (for pressure ≤ 250bar)			
Material(s) of wetted parts	Stainless Steel 316L, 17-4PH and 15-5PH			
Weight	30g without cable			
Enclosure protection	IP65 for absolute and sealed gage versions			







## CODIFICATION


Presssure & Temperature Miniature Sensor	PCM16	1	S	20bar	Α	29	03	Α	1	1	_
Output Signal											
mV/V		1									
Material											
Stainless Steel			S								
Range											
Example : 20bar				20bar							
Туре											
Absolute Gage Sealed Gage (ranges > 40bar)					A G SG						
Mechanical connection											
M8x1-6g male (ranges ≤ 250bar) M10x1-4h male 3/8-24 UNF-3A male						29 30 33					
Electrical Connection											
6-pin MIL C-26482 Receptable							03				
Compensated temperature range											
0 to +60°C -40 to +125°C 0 to +175°C								A D G			
Nonlinearity and hysteresis combined											
±0.25% FS typ. / ±0.35% FS max.									1		
Combined thermal zero & sensitivity shifts											
±0.02% EM/°C										1	
Options											
PT100 Thermal Probe											Т









## **DIMENSIONS**

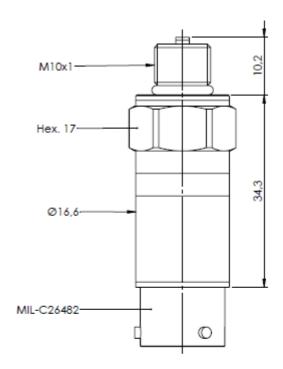

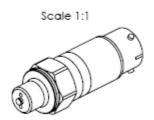

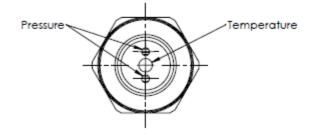








### WIRING

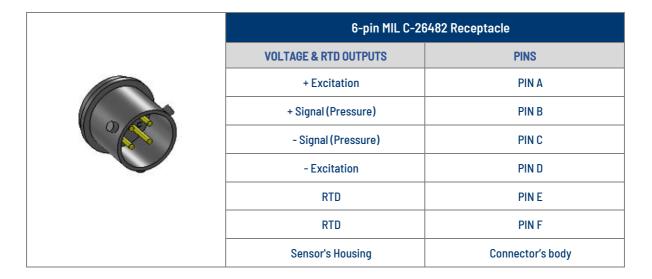

AGENT						